

# Manhole Inspection Summary

Manhole # S04CC1014MH

Printed On: 6/24/2010

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **04CC1** Node: **014** Status: **Found**

Insp Date: **4/16/08 1:44 PM**

Incomplete Comments

Crew: **RL SD**  
Inspector: **Grace**  
Firm: **URS**

**Location** Address: **5204 LIBERTY HEIGHTS**

Cross Street: **MARMON AVE**

**Manhole** Type: **Junction**

Location: **Roadway**

Ground Conditions: **Wet**

☐ Prev. Rehab

Weather: **Snow**

Subject To Ponding: **None**

Comments

**Cover**

Shape: **Circular**

Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment**

☒ Exists Material: **Brick**

☐ Parged Height: **6** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel**

Material: **Brick**

☐ Parged

Type: **Flat top**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel**

Material: **Brick**

☐ Parged

Shape: **Rectangular** Diameter: **60** (in.) Length: **60** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench**

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel**

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps**

Count: **3** Missing: **0** ☐ Corroded


**Surcharge**

☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View



Top View

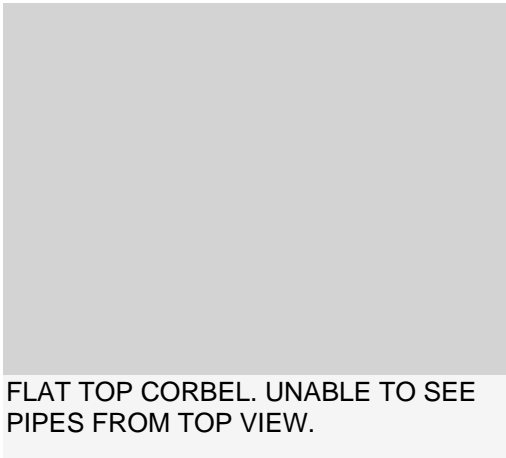

Top View



GRADE ADJUSTMENT



## Manhole Inspection Summary

Manhole # S04CC1014MH

Printed On: 6/24/2010

Page 3 of 4

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



PIPE DEBRIS

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.50** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **1** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.40** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

## Manhole Inspection Summary

Manhole # S04CC1014MH

Printed On: 6/24/2010

Page 4 of 4

10 in. Circular Gravity Sewer

7 O'Clock Inflow

Pipe In @ 7 O'Clock



Pipe Height: **10.8** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.40** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**


Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

8 O'Clock Inflow

Pipe In @ 8 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.40** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection